

CONDITION SURVEY DATA SHEET

BUILDING 2066

EXTERIOR ELEMENT

EXISTING
ORIGINAL FABRIC
ALTERED FABRIC
TYPE

NEEDS ATTENTION
SEE SURVEY NOTE
SPECIAL ITEM

REMARKS

LANDSCAPING

SIGNAGE	●					
DRAINAGE & GRADING	●			▲		SOME PONDING
LIGHTING	●			▲	8	ABANDONED SURFACE MOUNT CONDUIT AT WEST EAVE
PLANTING						

FOUNDATIONS

CONCRETE WALL	●					
CONCRETE PIERS						
SKIRTING						

WALLS

WOOD SIDING						
CONCRETE						
STUCCO						
CONCRETE/STONE FACE						
MASONRY	●	●		▲	3,6	OCCASIONAL DAMAGE FROM VEHICLES/HOLES IN WALLS
PAINT	●	●	●	▲		LOOSE, CHIPPED SOME RUSTING/SOFT PAINT PEELING
WOOD TRIM						
STEEL COLUMNS						
METAL TRIM	●			▲	9	SOME RUST
ASBESTOS SIDING						

ROOFS

COMPOSITION						
BUILT-UP						
METAL						
TILE	●	●		▲		SOME MOSS
FLASHING	●			▲		DAMAGED FLASH, EAST SIDE OF NORTH EAVE

ROOF ACCESSORIES

BELL TOWER						
CLERESTORY						
ATTIC VENTS	●			▲	2	SOME RUST ON VENTS
GUTTERS				▲		DAMAGE AT EAST END OF NORTH EAVE
SCUPPER BOXES						
DOWNSPOUTS						
MISC. PENETRATIONS						

DOORS

WOOD PANEL	●	●		▲	7	OUT OF CHARACTER
FLUSH WOOD						
FLUSH METAL						
GLASS LIGHTS	●					
HARDWARE	●					
TRANSOM						
WOOD OVERHEAD						
METAL OVERHEAD	●		62	▲		MOSS ON SILLS

WINDOWS

WOOD DOUBLEHUNG						
WOOD CASEMENT						
GLASS BLOCK						
VINYL						
WOOD VENT/HOPPER						
WOOD DECORATIVE						
WOOD FIXED						
METAL CASEMENT						
METAL AWNING/HOPPER	●	●	39, 40	▲	4,5	RUST SOME MISMATCHED & PAINTED GLAZING
METAL DECORATIVE						
SCREENS/BARS						

PORCHES

ROOFED						
ENCLOSED						
CONCRETE STEPS						
WOOD STEPS						
GRANITE STEPS						
BRICK PORCH & STEPS						
METAL RAILING						
WOOD RAILING						
COLUMNS						
ROOF BALUSTRADE						

FIRE ESCAPES

METAL						
CHIMNEYS						
MASONRY	●					
METAL						

CONDITION SURVEY

MASONRY SHOP BUILDING

1. Moss is evident on masonry sills
2. Roof ventilators are rusty.
3. Masonry is intrusively painted and soiled in various locations.
4. Highly visible replacement glass doesn't match original. Some is patterned, some is painted.
5. Metal sashes are rusting.
6. Masonry has been damaged by vehicles, several corners, almost all shop buildings, particularly at the adjacent, east end vehicle wash slabs..
7. Flush wood doors are out of character and several are delaminated.
8. Surface mounted area lighting is not appropriate to historic character of building.
9. Several eaves and doorways have been struck by large vehicles.
10. Building 2062: Cracks on north face and at southwest corner have been crudely grouted.
11. Buildings 2060 and 2065: Replacement masonry does not match original hollow brick masonry.
12. Varieties of visually intrusive, infill materials have been used on the majority of buildings including standard bricks, concrete masonry units and plywood.

MAINTENANCE AND REPAIR SCHEDULE

- A. IMMEDIATE
- B. 6 MO. - 1 YR.
- C. AS FUNDING PERMITS
- 6 MO. - 1 YR.
- + 2 YRS. - 4 YRS.
- 5 YRS. - 10 YRS.

BUILDING 2066

EXTERIOR ELEMENT

EXTERIOR ELEMENT	NEEDS REPAIR SEE ARTICLE	SEE ILLUSTRATION	ROUTINE MAINTENANCE			IN HOUSE SEE NOTE	REMARKS
			*	+	○		
LANDSCAPING							
SIGNAGE	2.3					▲	DEVELOP SIGNAGE PLAN
DRAINAGE & GRADING	2.2			●			
LIGHTING				●		▲	8. REMOVE ABANDONED CONDUIT
PLANTING	2.1		●				
FOUNDATIONS							
CONCRETE WALL					●	▲	CLEAN AND SEAL
CONCRETE PIERS							
SKIRTING							
WALLS							
WOOD SIDING							
CONCRETE							
STUCCO							
CONCRETE/STONE FACE							
MASONRY	B 4.2			●		▲	3.6 CLEAN REPAIR DAMAGE/REFINISH HOLES
PAINT	C					▲	REMOVE RUST/ REPAINT PEELING AREAS
WOOD TRIM							
STEEL COLUMNS							
METAL TRIM	4.5					▲	9 REPAIR - TAKE PREVENTIVE MEASURES
ASBESTOS SIDING							
ROOFS							
COMPOSITION							
BUILT-UP							
METAL							
TILE	C						REMOVE ANY MOSS - REPAIR BREAKAGE
FLASHING					●		CHECK FOR LEAKS
ROOF ACCESSORIES							
BELL TOWER							
CLERESTORY							
ATTIC VENTS	C 4.5			●		▲	2 REMOVE RUST - PAINT
GUTTERS	B		●			▲	REPAIR EAST END OF NORTH
SCUPPER BOXES							
DOWNSPOUTS				●			
MISC. PENETRATIONS							
DOORS							
WOOD PANEL				●			
FLUSH WOOD	C 6.7			●		▲	7 REPLACE
FLUSH METAL				●			
GLASS LIGHTS				●			
HARDWARE							
TRANSOM							
WOOD OVERHEAD							
METAL OVERHEAD							
WINDOWS							
WOOD DOUBLEHUNG	B 7.3					▲	1 REMOVE MOSS FROM SILLS
WOOD CASEMENT							
GLASS BLOCK							
VINYL							
WOOD VENT/HOPPER							
WOOD DECORATIVE							
WOOD FIXED							
METAL CASEMENT							
METAL AWNING/HOPPER	B 7.2				●	▲	4.5 REPLACE MISMATCHED GLASS/PAINT
METAL DECORATIVE							
SCREENS/BARS							
PORCHES							
ROOFED							
ENCLOSED							
CONCRETE STEPS							
WOOD STEPS							
GRANITE STEPS							
BRICK PORCH & STEPS							
METAL RAILING							
WOOD RAILING							
COLUMNS							
ROOF BALUSTRADE							
FIRE ESCAPES							
METAL							
CHIMNEYS							
MASONRY				●			
METAL							

MAINTENANCE AND REPAIR NOTES

MASONRY SHOP BUILDING

1. **MOSS ON SILLS**
 - a. Remove with natural bristle brush and bleach solution.
 - b. Rinse and dry.
2. **RUSTING VENTILATORS**
 - a. Sand to remove all rust.
 - b. Prime and paint.
3. **MASONRY**
 - a. As budget permits, remove paint and clean.
 - b. Pressure wash, repoint as required.
4. **GLAZING**
 - a. Replace mismatched glass panes to be consistent within each window.
5. **STEEL SASH**
 - a. Remove all rust with wire brush, sanding and steel wool.
 - b. Protect glass.
 - c. Prime immediately.
 - d. Replace loose, missing or cracked glazing putty.
 - e. Paint with oil based semi-gloss exterior paint.
 - f. Oil hardware.
6. **DAMAGE TO MASONRY**
 - a. Remove all rust from steel, if exposed.
 - b. Prime with rust inhibiting primer.
 - c. Rebuild damaged corner with matching units, coursing and mortar color.
 - d. Place bollards 1' - 0" away from building corners.
7. **DOORS**
 - a. Replace flush doors with doors matching original.
 - b. See Door Types 53 and 54.
8. **LIGHTING**
 - a. Consider more appropriate lighting. See fixtures on 2051.
9. **DAMAGE TO EAVES AND DOORWAYS**
 - a. Straighten bent steel items.
 - b. Replace damaged wood frames and trims.
 - c. Prime and paint.
 - d. Consider steel corner guards at doorways.
10. **GROUTED CRACKS**
 - a. Remove inappropriate mortar.
 - b. Replace with mortar matching existing joint and color.
11. **REPLACEMENT MASONRY UNITS**
 - a. As budget permits remove mismatched repairs and replace with matching hollow masonry units.
12. **INFILL**
 - a. As budget permits, remove mismatched materials and replace with matching hollow masonry units.